

**The Jewish Center
Type: 1**



(Typical Pre-Restoration Photograph)

Description: Chandelier

Lights: 13 (6 Uplights & 7 Downlights)

Work Scope:

- Existing fixture shall be disassembled, all paint is removed from steel components and conserve the original steel finish. Application of UV resistant protective top coating of lacquer.
- Remove gold painted finish from all brass components and apply an antique brass patina with burnished highlights. Apply a UV resistant lacquer topcoat.
- Replace (36) opal glass diffusers with new opal glass diffusers on chandelier arms. (Type B Dimensions: 4-7/8" x 10-3/8" x 4-5/8")
- Replace (6) opal glass diffusers with new opal glass diffusers on bottom of chandelier. (Type A Dimensions: 8" x 16" x 8")
- Replace and rewire all electrical components with UL listed products and test in accordance with UL 1598 standards. UL label on all fixtures. Medium base sockets to be utilized.
- Repair all mechanical defects to glass fitters.
- Replace all glass set screws.

GRAND LIGHT

Historic Lighting Restoration & Custom Lighting

104 Day St. Seymour, Ct 06483

PH: 1-800-922-1469 Fax: 203-785-1184

Web: GrandLight.com

Project: The Jewish Center

Lamp: TBD

Socket: (13) Medium

S/O #: 72161

Finish: Brass/Gold

Circuits: 1

Glass: Opal


Voltage: 120v

Material: Brass/Steel

Type: Indoor

QTY: 6 VOL: FINAL Date: 7/22/19 Type: 1

The Jewish Center
Type: 1

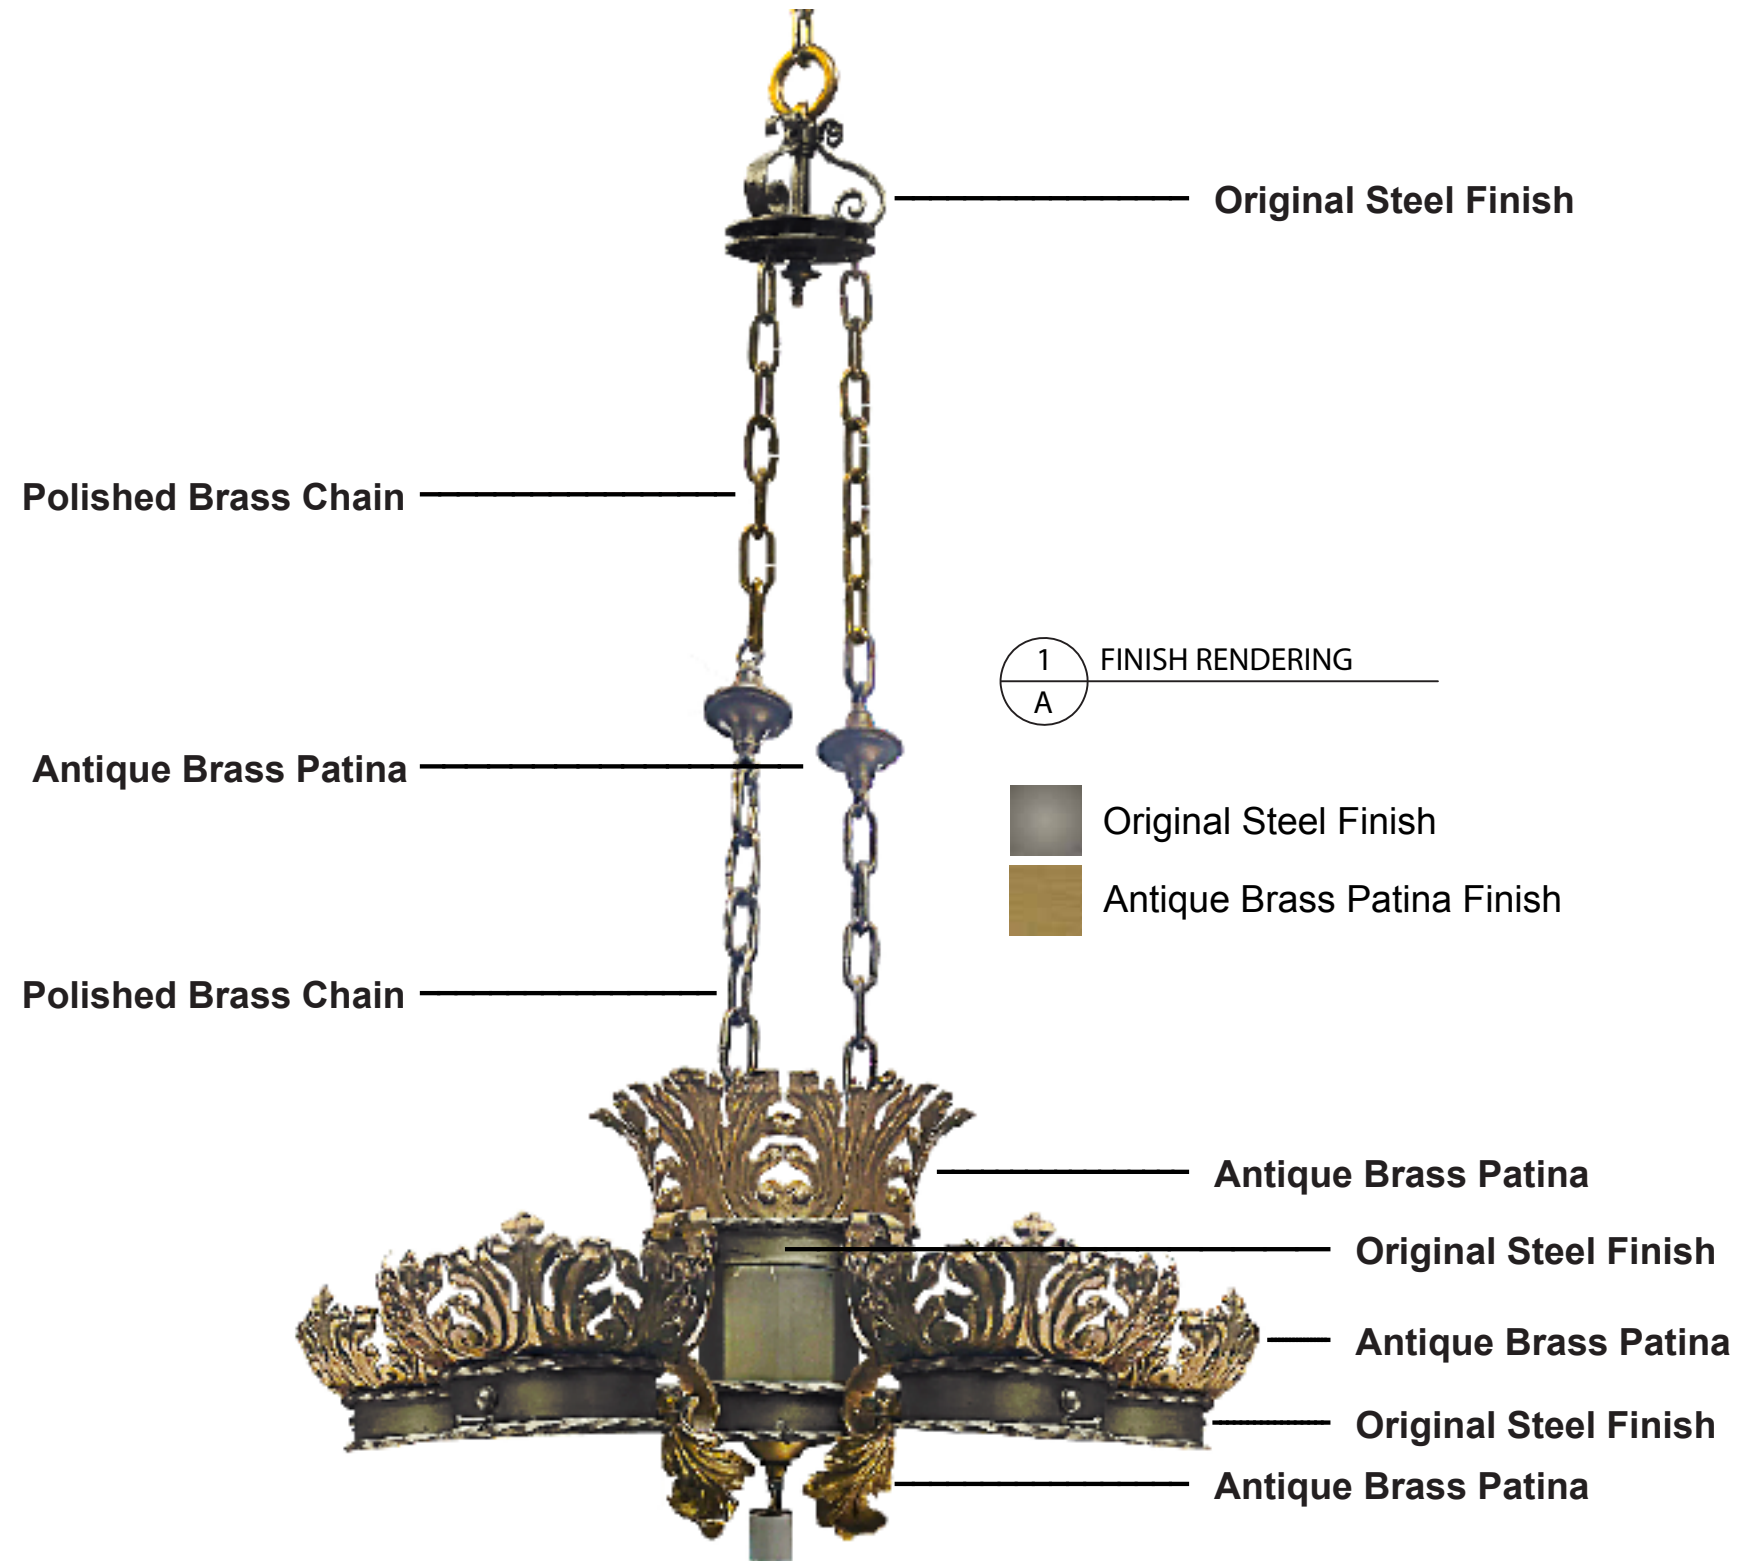

GRAND LIGHT
Historic Lighting Restoration & Custom Lighting
104 Day St. Seymour, Ct 06483
PH: 1-800-922-1469 Fax: 203-785-1184
Web: GrandLight.com

Project: The Jewish Center

Lamp: TBD	Socket: (13) Medium	S/O #: 72161
Finish: Brass/Gold	Circuits: 1	Glass: Opal
Voltage: 120v	Material: Brass/Steel	Type: Indoor

QTY: 6 VOL: FINAL Date: 7/22/19 Type: 1